OMB Control No.: 2127-0004

Part 573 Safety Recall Report

Manufacturer Name : Chrysler (FCA US LLC) Submission Date : FEB 26, 2019 NHTSA Recall No.: 19V-051 Manufacturer Recall No.: V12

Manufacturer Information :

Manufacturer Name : Chrysler (FCA US LLC)

48326-2757 Company phone : 1-800-853-1403

Vehicle Information :

Vehicle 1: 2	2019-2019 Ram 1500	
Vehicle Type :		
Body Style : P	PICKUP TRUCK	
Power Train : N	NR	
r s 2 s id n	Some 2019 MY Ram 1500 vehicles may be equipped with a 12" touchscreen display radio combined with the base heating, ventilation and air conditioning ("HVAC") system. Fifteen (15) 2019 MY Ram 1500 vehicles were built between November 15, 2018, and November 16, 2018 with the suspect combination of radio and HVAC system. Scope of vehicles is based on vehicle build configuration traceability allowing identification of all suspect vehicles. Similar vehicles not included in this recall are not equipped with the 12" touchscreen display radio combined with the base HVAC system.	
Production Dates : NOV 15, 2018 - NOV 16, 2018		
VIN Range 1 : Begin : NR End : NR		
Description of Noncompliance :		
	 Federal Motor Vehicle Safety Standard ("FMVSS") 571.103 S4.1 requires 2019 MY Ram 1500 vehicles to "have a windshield defrosting and defogging system." Vehicles built with the 12" touchscreen display radio combined with the base HVAC system do not have a functioning windshield defrosting and defogging system. 	
FMVSS 1 FMVSS 2	: 103 - Windshield defrosting and defogging systems : NR	
Description of the Safety Risk	: The lack of a functioning windshield defrosting and defogging system may decrease outward visibility in certain driving conditions and can cause	

The information contained in this report was submitted pursuant to 49 CFR §573



19V-051

Address: 800 Chrysler Drive CIMS 482-00-91 Auburn Hills MI

Population :

Number of potentially involved : 15 Estimated percentage with defect : 100 %

Part 573 Safety Recall Report

19V-051

vehicle crash without prior warning.

Description of the Cause : NR

Identification of Any Warning
that can Occur :Customers may realize that the HVAC system is not functioning by a lack of
response to control inputs in the 12" touchscreen display radio interface.

Supplier Identification :

Component Manufacturer

Name : NR Address : NR NR Country : NR

Chronology :

 \cdot On January 10, 2019, the FCA US LLC ("FCA US") Vehicle Safety and Regulatory Compliance ("VSRC") organization became aware of the potential for an inoperative HVAC system on 2019 MY DT, as a result of input from the FCA US Quality organization.

 \cdot On January 11, 2019, the FCA US VSRC organization opened an investigation as a result of the potential for an FMVSS 103 noncompliance.

 \cdot As of January 11, 2019, FCA US identified approximately 2 CAIRs, 0 VOQs and 1 field reports related to this issue.

• As of January 11, 2019, total warranty is 5 at 0.02c/1000.

· As of January 11, 2019, FCA US is unaware of any accidents or injuries potentially related to this issue.

 \cdot On January 15, 2019, testing was completed which showed that the base HVAC system, including the windshield defrosting and defogging system, does not function with the controls provided in the vehicle when combined with the 12" touchscreen display radio.

 \cdot On January 17, 2019, FCA US determined, through the Vehicle Regulations Committee, to conduct a voluntary safety recall of the affected vehicles.

The information contained in this report was submitted pursuant to 49 CFR §573

Description of Remedy :

Description of Remedy Program :	FCA US will conduct a Voluntary Safety Recall to repurchase affected vehicles.
	FCA US has a longstanding policy and practice of reimbursing owners who have incurred the cost of repairing a problem that subsequently becomes the subject of a field action. To ensure consistency, FCA US, as part of the owner letter, will request that customers send the original receipt and/or other adequate proof of payment to the company for confirmation of the expense.
	Comment: The combination of the 12" touchscreen display radio and the base HVAC system, are incompatible.
Identify How/When Recall Condition NR was Corrected in Production :	
Recall Schedule :	
Description of Recall Schedule :	** 01/24/2019: FCA US will notify dealers and begin notifying owners on or about March 15, 2019.

Planned Dealer Notification Date :MAR 15, 2019 - MAR 15, 2019Planned Owner Notification Date :MAR 15, 2019 - MAR 15, 2019

* NR - Not Reported